

Munnariyippu 2014 Malayalam Dvdrip Downloads

Trouble Shooting continued...

- 1) UV LAMP FLICKERING, ALARM ON
1. Failed lamp.
 2. Incorrect starter (use only E300 electronic starter in SF9000, SF9005, SF9405, UV40-20 and UV75-25, SF 10000 and UV130-40 has no starter).
 3. Faulted lamp or failed ballast.
- 2) UV LAMP OUT, ALARM ON
1. Lamp failed.
 2. Poor connection to lamp (check/clean connections/ joints).
 3. Starter failed or loose in socket (not applicable to SF10000 and UV130-40).
 4. Ballast failed (optional).
- 3) LAMP ON, ALARM ON
1. Faulty circuit board.
- 4) LAMP OUT, ALARM OFF
1. Loose connection, faulty circuit board or possibly faulty lamp.

WARNING: When servicing or attending your StarBU® always ensure power is switched off and lock out/tagged. Electrical connections should be serviced only by qualified persons. If the electrical supply lead of this system is damaged, it must only be replaced by authorized Denvy service personnel as special tools are required.

Caution: Care should also be taken when servicing or disassembling the unit and associated pipework to avoid possible injury from pressurized water. Using pressure release procedure by opening a tap on the discharge side of the unit and allow any water in the unit to cool before attempting to dismantle.

Service Parts

Replacement Lamp	
Sub SF9000, SF9005, SF9405, UV40-20 & UV75-25	GF984945
Sub UV130-40 and SF 10000	GF984925
Ballast	
Sub SF9000, SF9005, SF9405, UV40-20 & UV75-25	Q654
Sub UV130-40 and SF 10000	Q690
Quartz Sleeve Pressure Ring	S113
Starter	
Sub SF9000, SF9405, UV40-20 & UV75-25	E300
Sub UV130-40 and SF 10000	No starter
On/Off	S242N70 (2 per sleeve)
Lamp Connector	
All models	S1142

Congratulations on your purchase of a high quality Denvy StarBU® Ultra Violet water treatment system. All components have been designed and manufactured to give trouble free, reliable operation.

Your new StarBU® system incorporates a lamp failure system design feature that alerts you to the moment of a lamp failure by :-


1. A lamp failure red LED
2. An audible alarm
3. Remote alarm contacts (only in UV130-40 MkII and SF 10000)

In addition the UV130-40 MkII and SF 10000 features a UV timer. When the alarm 'beeps' on and off, the lamp is due for change or has effective treatment is required.

As part of the timing function, the red LED will flash quickly once every ten seconds, but the alarm will not sound. This is not a fault indication.

Before installing your new StarBU® please read all instructions carefully as failure to follow the instructions may void the warranty. The system is designed to handle clean water. The system should not be used for any other purpose without specific advice from Denvy. The use of the system with fertilizers, herbicides and other additives of a hazardous nature is not recommended.

The equipment is not intended for use by young children or other persons who are not instructed. Young children should be supervised to ensure they do not play with the equipment.

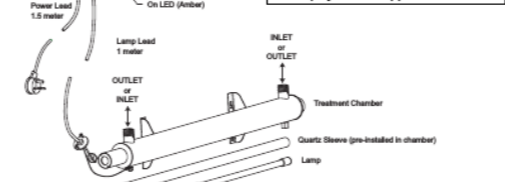

NOTE: The quartz sleeve has been factory fitted and there is no need to dismantle. Before servicing always ensure read the Replacement section of these instructions completely.

Preparing your system

On receiving your StarBU® system from its carton you should check all components, including the lamp, to ensure all are present and have not been damaged in transportation. You should have:

1. Power supply control box with indicator light and electrical box.
2. UV lamp.
3. Treatment chamber with mounting brackets.

DOWNLOAD: <https://imurli.com/2a10ca>



0b01ecf03

<https://coub.com/stories/1294335-creepy-vision-free-download-patch>
<http://dwingofeemi.umblr.fr/2021/12/01/ls-land1-issue-02-assorties-las-001-by-zic/>
<http://telegra.ph/1st-Studio-Siberian-Mouse-Pc-License-Free-X64-Serial-Zip-12-01>

<https://assets.pinshape.com/uploads/image/file/458282/Gorillaz-Demon-Days-full-album-zip.html>
<https://assets.pinshape.com/uploads/image/file/458281/LordOfTheRingsTheFellowshipoftheRing2001720p264Y1FYmp4.html>
<https://assets.pinshape.com/uploads/image/file/458280/patwebb.html>